TWIN CITIES

H-2H, L-14G

IAP, AD

GRAND FORKS INTL (GFK) 5 NW UTC-6(-5DT) N47°56.96′ W97°10.57′

845 B S4 FUEL 100LL, JET A 0X 3 TPA—See Remarks LRA Class I, ARFF Index B RWY 17R-35L: H7351X150 (ASPH-GRVD) S-75, D-160, ST-175, DT-270 HIRL

HIRL G

1 / K

RWY 17R: REIL. PAPI(P4L)—GA 3.0° TCH 53'. Rgt tfc.

RWY 35L: MALSR. PAPI(P4L)-GA 2.76° TCH 61'.

RWY 09L-27R: H4206X100 (CONC) S-43, D-55, DT-115 MIRL RWY 09L: VASI(V4L)—GA 3.0° TCH 39'.

RWY 27R: REIL. VASI(V4L)-GA 3.0° TCH 45'. Rgt tfc.

RWY 17L-35R: H3901X75 (CONC) S-12.5 MIRL

RWY 17L: PAPI(P4L)-GA 3.0° TCH 21'.

RWY 35R: PAPI(P4L)-GA 3.0° TCH 21'. Rgt tfc.

LAND AND HOLD SHORT OPERATIONS


 LANDING
 HOLD SHORT POINT
 DIST AVBL

 RWY 27R
 17R-35L
 3000

 RWY 35L
 09L-27R
 4600

AIRPORT REMARKS: Attended continuously. Birds on and invof arpt. Heavy student training activity within 15 miles of airport. Heavy student helicopter training at arpt between parallel twys. PAEW 0530–1200Z‡. ARFF Index B svc avbl 1100–0600Z‡; other times PPR for air carrier operations with more than 30 passenger seats. Call arpt manager on 701–795–6984. Ctc Grand Forks FSS for

Call arpt manager on 701–795–6984. Ctc Grand Forks FSS for surface conditions. Current airfield conditions may be obtained via

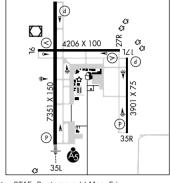

the airport. When twr clsd snow removal equipment operators monitor CTAF. Customs avbI Mon–Fri 1900–03002‡, other times on req 701–772–3301. Lgtd entrance road 1600′ east of Rwy 17R–35L. Rwy 17L–35R CLOSED 0800–12002‡. Rwy 17L–35R and Twy C not avbI for air carrier acft with more than 30 passenger seats. Western most 100 ft of Twy C1 is an extension of the Bravo apron and not visible from the twr. Twy G and Twy U clsd to fixed wing acft 12,500 lbs and over. TPA 1645(800) for light aircraft and 2345(1500) for large aircraft. ACTIVATE REIL Rwy 27R and Rwy 17R—CTAF. When twr clsd ACTIVATE HIRL Rwy 17R–35L, and MALSR Rwy 35L, MIRL Rwy 09L–27R—CTAF. MIRL Rwy 17L–35R preset on low ints 0530–08002‡. VASI Rwy 09L and 27R, PAPI Rwy 17L, Rwy 35R, Rwy 17R and Rwy 35L opr continuously. Flight Notification Service (ADCUS) available.

WEATHER DATA SOURCES: ASOS (701) 772-3486. HIWAS 114.3 GFK.

COMMUNICATIONS: CTAF 118.4 ATIS 119.4 UNICOM 122.95

FSS (GFK) TF 1-800-WX-BRIEF. NOTAM FILE GFK.

RCO 122.6 122.2 (GRAND FORKS FSS).

R APP/DEP CON 118.1

TOWER 118.4 120.55 (1200-0530Z‡) GND CON 124.575

AIRSPACE: CLASS D svc 1200-0530Z± other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE GFK.

(H) VORW/DME 114.3 GFK Chan 90 N47°57.29' W97°11.12' at fld. 841/9E. HIWAS.

HISER NDB (LOM) 345 GF N47°50.78′ W97°10.89′ 356° 6.2NM to fld.

ILS/DME 109.1 I-GFK Chan 28 Rwy 35L. Class IC. LOM HISER NDB. ILS/DME unmonitored when twr clsd. LOC back course unusable byd 15 NM.

COMM/NAV/WEATHER REMARKS: Freq 121.5 not available at twr. Weather available on ATIS when twr closed. Ctc Grand Forks radio for airport advisory service on 118.4 when twr is clsd. Ctc Grand Forks radio for airport advisory service on 118.4 when twr is clsd.

GRENORA CENTENNIAL (7N6) 1 NE UTC-7(-6DT) N48°37.53′ W103°55.80′

TWIN CITIES

2145

RWY 17-35: 2600X100 (TURF)

RWY 17: P-line

AIRPORT REMARKS: Unattended. Arpt CLOSED winter months. No snow removal, confirm rwy condition phone 701–694–3391. Rwy 17–35 violates 5' rwy visibility clearance. -5' pond 50' from Rwy 17 thld. Rwy 17–35 dalgt markers on four corners and edges with black/white cones.

COMMUNICATIONS: CTAF 122.9

GRAND FORKS FSS (GFK) TF 1-800-WX-BRIEF. NOTAM FILE GFK.